



Groundsure Geoinsight

Address: TOWNSEND NURSERY, 96, TOWNSEND LANE, HARPENDEN, AL5 2RH
Date: Aug 3, 2015
Reference: GS-2321708
Client: Geo-Environmental Investigations

NW N NE



SW S SE

Aerial Photograph Capture date: 21-Sep-2006
Grid Reference: 512248,214432
Site Size: 10.68ha

Contents Page

Overview of Findings.....	5
1 Geology.....	8
1.1 Artificial Ground Map.....	8
1 Geology.....	9
1.1 Artificial Ground.....	9
1.1.1 Artificial/ Made Ground.....	9
1.1.2 Permeability of Artificial Ground.....	9
1.2 Superficial Deposits and Landslips Map.....	10
1.2 Superficial Deposits and Landslips.....	11
1.2.1 Superficial Deposits/ Drift Geology.....	11
1.2.2 Permeability of Superficial Ground.....	11
1.2.3 Landslip.....	11
1.2.4 Landslip Permeability.....	12
1.3 Bedrock and Faults Map.....	13
1.3 Bedrock, Solid Geology & Faults.....	14
1.3.1 Bedrock/ Solid Geology.....	14
1.3.2 Permeability of Bedrock Ground.....	14
1.3.3 Faults.....	14
1.4 Radon Data.....	15
1.4.1 Radon Affected Areas.....	15
1.4.2 Radon Protection.....	15
2 Ground Workings Map.....	16
2 Ground Workings.....	17
2.1 Historical Surface Ground Working Features derived from Historical Mapping.....	17
2.2 Historical Underground Working Features derived from Historical Mapping.....	17
2.3 Current Ground Workings.....	18
3 Mining, Extraction & Natural Cavities Map.....	19
3 Mining, Extraction & Natural Cavities.....	20
3.1 Historical Mining.....	20
3.2 Coal Mining.....	20
3.3 Johnson Poole and Bloomer.....	20
3.4 Non-Coal Mining.....	20
3.5 Non-Coal Mining Cavities.....	21
3.6 Natural Cavities.....	21
3.7 Brine Extraction.....	22
3.8 Gypsum Extraction.....	22
3.9 Tin Mining.....	22
3.10 Clay Mining.....	22
4 Natural Ground Subsidence.....	23
4.1 Shrink-Swell Clay Map.....	23
4.2 Landslides Map.....	24
4.3 Ground Dissolution Soluble Rocks Map.....	25
4.4 Compressible Deposits Map.....	26
4.5 Collapsible Deposits Map.....	27
4.6 Running Sand Map.....	28
4 Natural Ground Subsidence.....	29
4.1 Shrink-Swell Clays.....	29
4.2 Landslides.....	29
4.3 Ground Dissolution of Soluble Rocks.....	30

4.4 Compressible Deposits.....	30
4.5 Collapsible Deposits.....	30
4.6 Running Sands.....	30
5 Borehole Records Map.....	32
5 Borehole Records.....	33
6 Estimated Background Soil Chemistry.....	34
7 Railways and Tunnels Map.....	35
7 Railways and Tunnels.....	36
7.1 Tunnels	36
7.2 Historical Railway and Tunnel Features	36
7.3 Historical Railways.....	37
7.4 Active Railways.....	37
7.5 Railway Projects.....	37

Overview of Findings

The Groundsure Geosight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Shallow Mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1:Geology

1.1 Artificial Ground	1.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	1.1.2 Are there any records relating to permeability of artificial ground within the study site* boundary?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?	Yes
	1.2.2 Are there any records relating to permeability of superficial geology within the study site boundary?	Yes
	1.2.3 Are there any records of landslip within 500m of the study site boundary?	No
	1.2.4 Are there any records relating to permeability of landslips within the study site boundary?	No
1.3 Bedrock, Solid Geology & Faults	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records relating to permeability of bedrock within the study site boundary?	Yes
	1.3.3 Are there any records of faults within 500m of the study site boundary?	No
1.4 Radon data	1.4.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?	The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level
	1.4.2 Is the property in an area where Radon Protection Measures are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment?	No radon protective measures are necessary

Section 2:Ground Workings	On-site	0-50m	51-250	251-500	501-1000
2.1 Historical Surface Ground Working Features from Small Scale Mapping	0	2	5	Not Searched	Not Searched
2.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
2.3 Current Ground Workings	0	0	1	0	5

Section 3: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
3.1 Historical Mining	0	0	0	0	0
3.2 Coal Mining	0	0	0	0	0
3.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
3.4 Non-Coal Mining	2	2	1	4	7
3.5 Non-Coal Mining Cavities	0	0	0	0	0
3.6 Natural Cavities	0	0	1	0	0
3.7 Brine Extraction	0	0	0	0	0
3.8 Gypsum Extraction	0	0	0	0	0
3.9 Tin Mining	0	0	0	0	0
3.10 Clay Mining	0	0	0	0	0
<hr/>					
Section 4: Natural Ground Subsidence	On-site				
4.1 Shrink Swell Clay	Low				
4.2 Landslides	Very Low				
4.3 Ground Dissolution of Soluble Rocks	Moderate				
4.4 Compressible Deposits	Negligible				
4.5 Collapsible Deposits	Very Low				
4.6 Running Sand	Negligible				
<hr/>					
Section 5: Borehole Records	On-site	0-50m	51-250		
5 BGS Recorded Boreholes	0	0	1		
<hr/>					
Section 6: Estimated Background Soil Chemistry	On-site	0-50m	51-250		
6 Records of Background Soil Chemistry	4	1	9		
<hr/>					
Section 7: Railways and Tunnels	On-site	0-50m	51-250	251-500	
7.1 Tunnels	0	0	0	Not Searched	
7.2 Historical Railway and Tunnel Features	0	0	0	Not Searched	
7.3 Historical Railways	0	2	0	Not Searched	
7.4 Active Railways	0	0	0	Not Searched	

Section 7:Railways and Tunnels


On-site 0-50m 51-250 251-500

7.5 Railway Projects

0 0 0 0

1 Geology



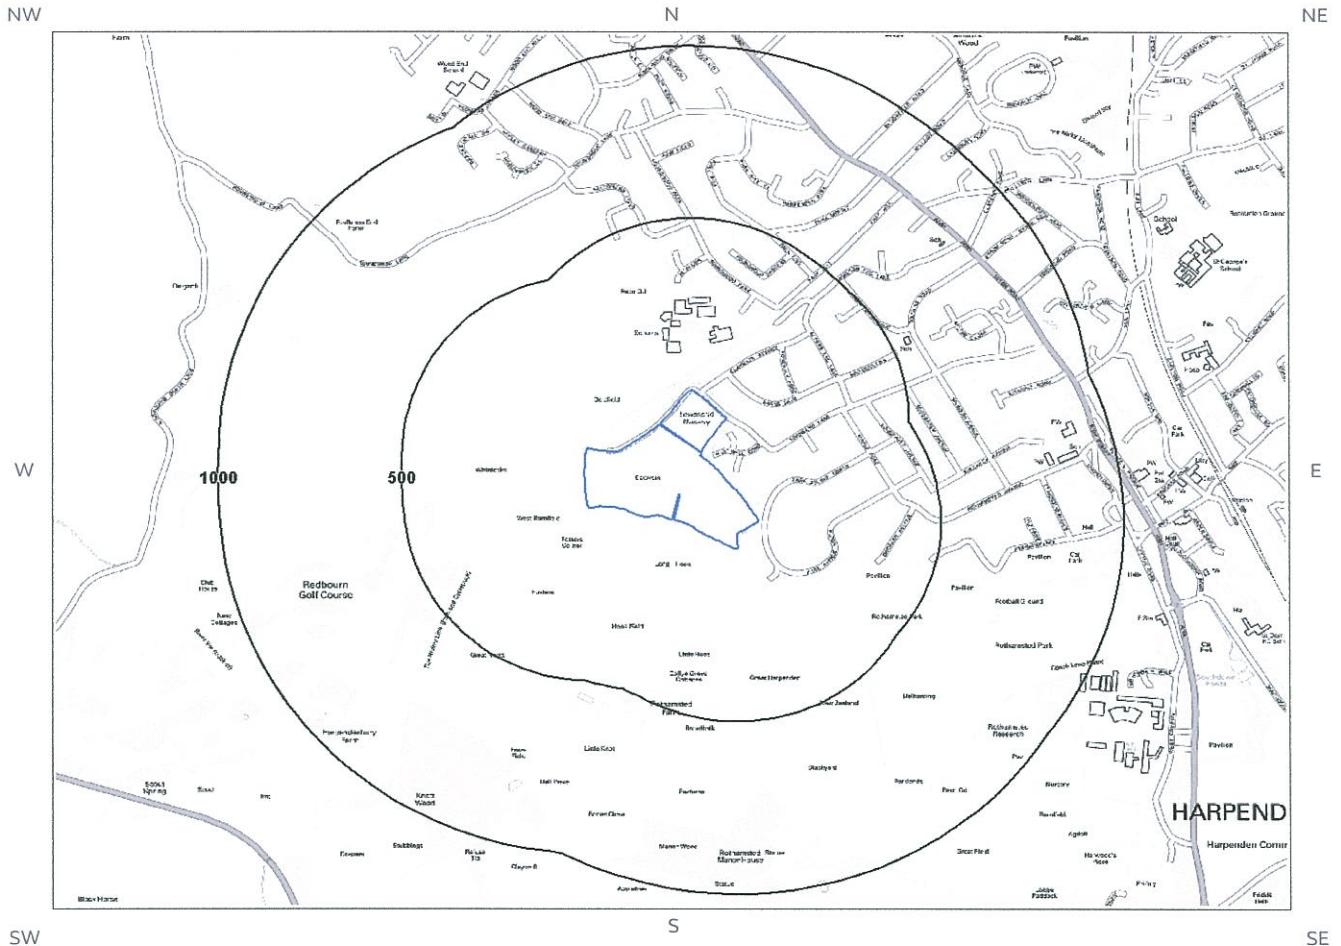





1.1 Artificial Ground Map



Artificial Ground Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

- | | | | | | |
|---|--------------------|---|---------------------------|---|-------------------------------|
|  | Site Outline |  | Made Ground (undivided) |  | Disturbed Ground (undivided) |
|  | Search Buffers (m) |  | Worked Ground (undivided) |  | Landscaped Ground (undivided) |
| | |  | Infilled Ground |  | Reclaimed Ground |

1 Geology

1.1 Artificial Ground

1.1.1 Artificial/ Made Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No:239

Are there any records of Artificial/Made Ground within 500m of the study site boundary? No

Database searched and no data found.

1.1.2 Permeability of Artificial Ground

Are there any records relating to permeability of artificial ground within the study site boundary? No

Database searched and no data found.

1.2 Superficial Deposits and Landslips

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? Yes

ID	Distance (m)	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	CWF	CLAY-WITH-FLINTS FORMATION	CLAY, SILT, SAND AND GRAVEL [UNLITHIFIED DEPOSITS CODING SCHEME]
2	71.0	N	CWF	CLAY-WITH-FLINTS FORMATION	CLAY, SILT, SAND AND GRAVEL [UNLITHIFIED DEPOSITS CODING SCHEME]
3	299.0	NE	CWF	CLAY-WITH-FLINTS FORMATION	CLAY, SILT, SAND AND GRAVEL [UNLITHIFIED DEPOSITS CODING SCHEME]

1.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? Yes

Distance (m)	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Mixed	High	Very Low

1.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.


1.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site** boundary? No

Database searched and no data found.

* This includes an automatically generated 50m buffer zone around the site

1.3 Bedrock and Faults Map

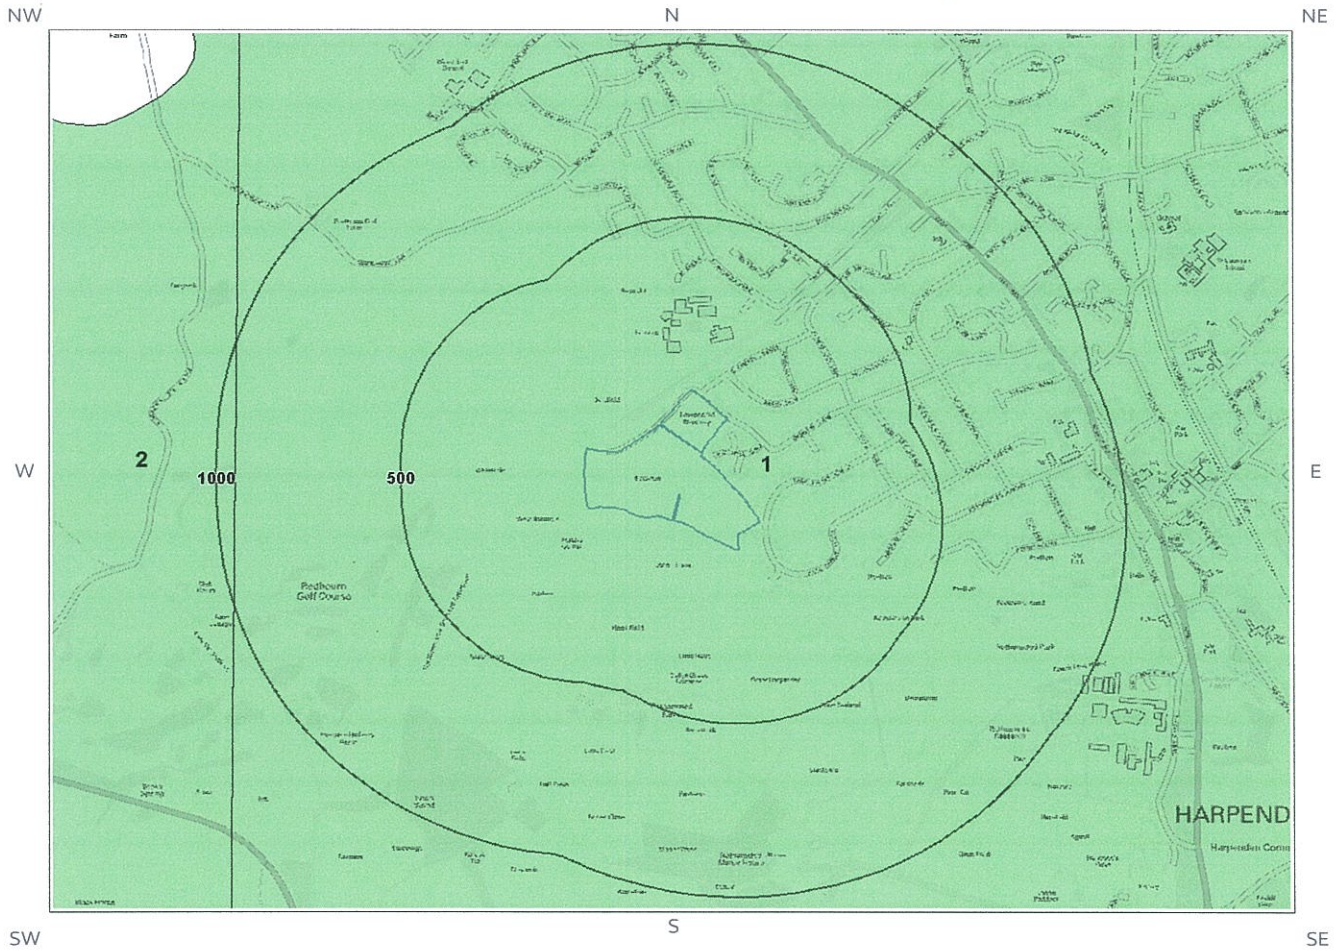

Bedrock and Faults Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.



Site Outline



Search Buffers (m)

1.3 Bedrock, Solid Geology & Faults

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No:239

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/ Solid Geology within 500m of the study site boundary:

ID	Distance (m)	Direction	LEX Code	Description	Rock Age
1	0.0	On Site	LESE-CHLK	Lewes Nodular Chalk Formation And Seaford Chalk Formation (undifferentiated) - Chalk	Santonian / Turonian

1.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site* boundary? Yes

Distance (m)	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Fracture	Very High	Very High

1.3.3 Faults

Are there any records of Faults within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as Faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

* This includes an automatically generated 50m buffer zone around the site

1.4 Radon Data


1.4.1 Radon Affected Areas

Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level

1.4.2 Radon Protection

Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary



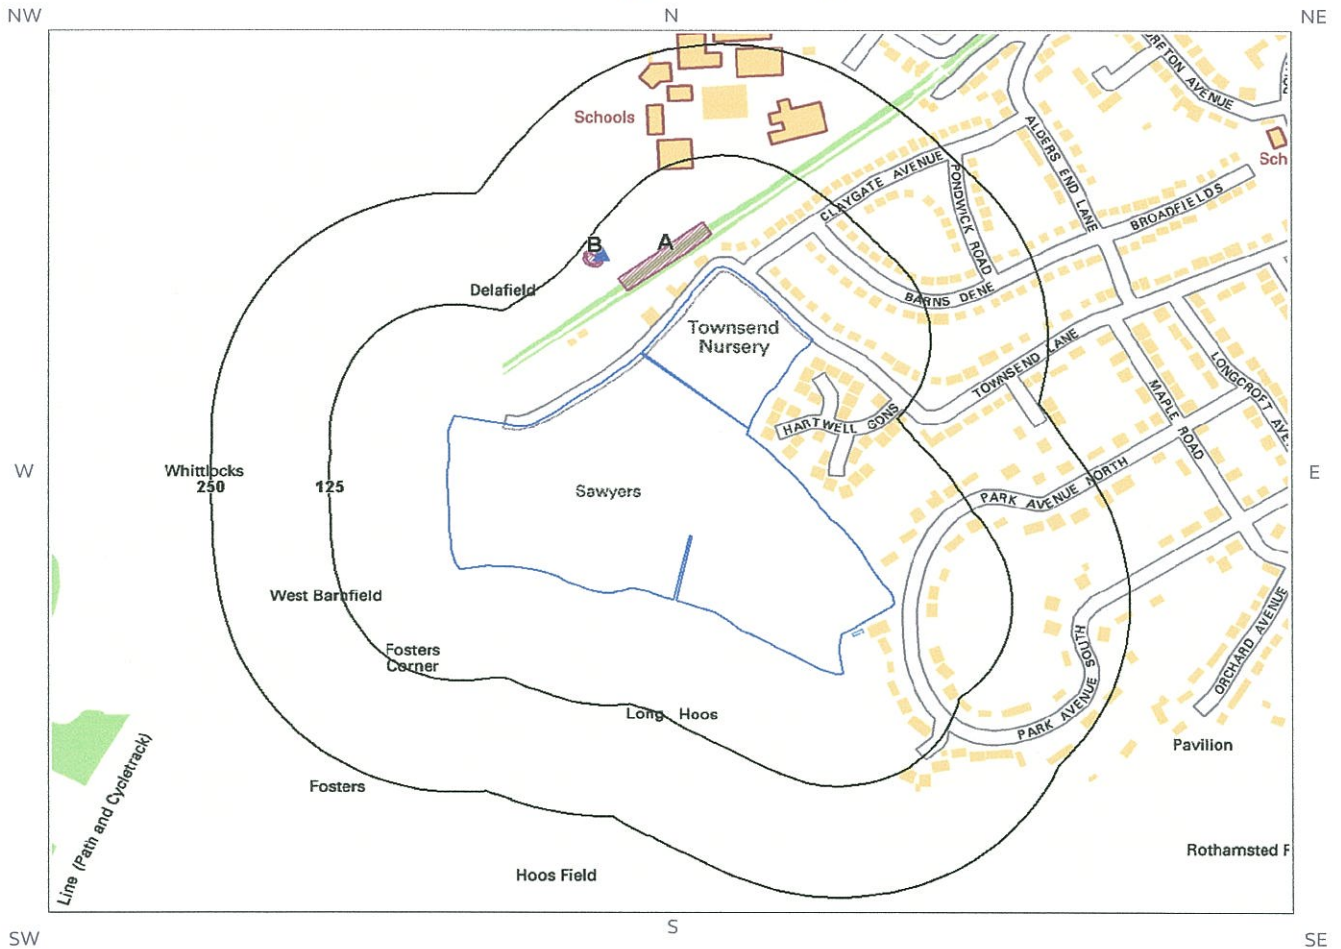



2 Ground Workings Map



Ground Workings Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

-  Site Outline
-  125 Search Buffers (m)
-  250 Search Buffers (m)
-  Historic Surface Ground Workings
-  Historic Underground Workings
-  Current Ground Workings

2 Ground Workings

2.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping.

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? Yes

The following Historical Surface Ground Working Features are provided by Groundsure:

ID	Distance (m)	Direction	NGR	Use	Date
1A	33.0	NW	512173 214553	Cuttings	1922
2A	33.0	NW	512173 214553	Cuttings	1878
3B	97.0	NW	512098 214550	Gravel Pit	1899
4B	97.0	NW	512098 214550	Unspecified Pit	1922
5B	97.0	NW	512098 214550	Unspecified Pit	1878
6B	99.0	NW	512097 214552	Unspecified Pit	1951
7B	101.0	NW	512093 214550	Gravel Pit	1899

2.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? No

Database searched and no data found.

2.3 Current Ground Workings


This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? Yes

The following Current Ground Workings information is provided by British Geological Survey:

ID	Distance (m)	Direction	NGR	Commodity Produced	Pit Name	Type of working	Status
8B	103.0	NW	512105 214556	Sand & Gravel	Fatcornersend Farm Gravel Pit	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
Not shown	835.0	S	511743 213394	Chalk	Knot Wood Chalk Pit	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
Not shown	836.0	NE	512802 215162	Sand & Gravel	Harpenden Gravel Pit	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
Not shown	884.0	N	512467 215395	Sand & Gravel	Harpenden Gravel Pit	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
Not shown	904.0	NE	512782 215265	Chalk	Harpenden Gravel Pit	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
Not shown	916.0	SW	511256 213610	Chalk	Harpendenbury Farm Chalk Pit	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased

3 Mining, Extraction & Natural Cavities Map

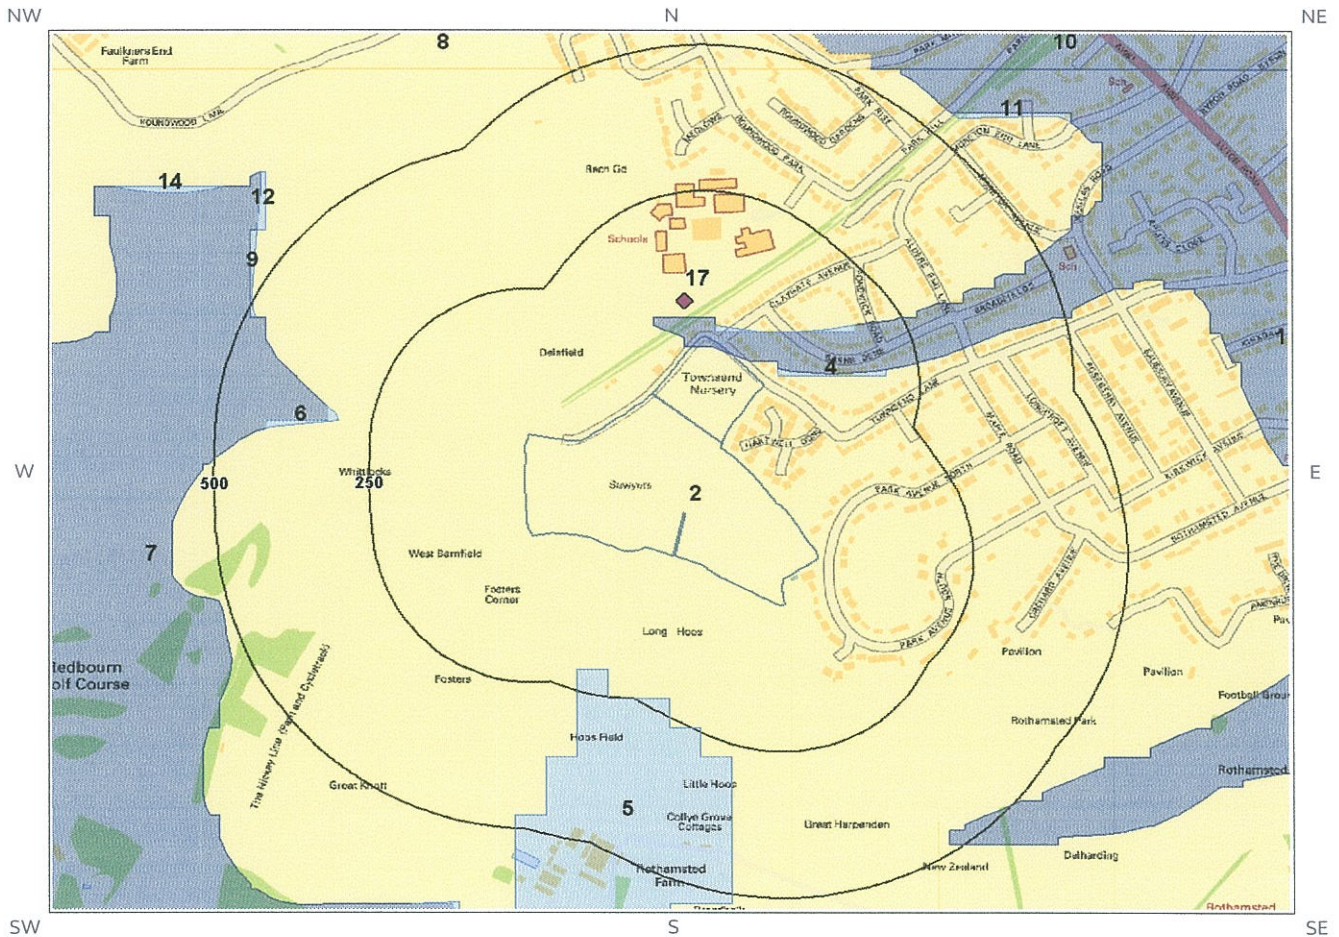

Mining, Extraction and Natural Cavities Legend

Mapping sourced from 

© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

- | | | | | | |
|---|--------------------|---|--------------------------|---|-----------------|
|  | Site Outline |  | Historical Mining |  | Highly likely |
|  | Search Buffers (m) |  | Non-Coal Mining Cavities |  | Likely |
| | |  | Natural Cavities |  | Unlikely |
| | | | |  | Highly unlikely |
| | | | |  | Rare |

3 Mining, Extraction & Natural Cavities

3.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

3.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

3.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

3.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? Yes

The following non-coal mining information is provided by the BGS:

ID	Distance (m)	Direction	Name	Commodity	Assessment of likelihood
1	0.0	On Site	Not available	Chalk	Occasional minor mining may have occurred but of restricted extent.
2	0.0	On Site	Not available	Chalk	Small scale mining may have occurred but restricted in extent.
3	14.0	NE	Not available	Chalk	Rare and localised small scale mining may have occurred.
4	26.0	NE	Not available	Chalk	Rare and localised small scale mining may have occurred.

ID	Distance (m)	Direction	Name	Commodity	Assessment of likelihood
5	203.0	S	Not available	Chalk	Rare and localised small scale mining may have occurred.
6	303.0	W	Not available	Chalk	Rare and localised small scale mining may have occurred.
7	321.0	W	Not available	Chalk	Occasional minor mining may have occurred but of restricted extent.
8	458.0	N	Not available	Chalk	Small scale mining may have occurred but restricted in extent.
9	483.0	NW	Not available	Chalk	Rare and localised small scale mining may have occurred.
10	523.0	N	Not available	Chalk	Occasional minor mining may have occurred but of restricted extent.
11	544.0	NE	Not available	Chalk	Rare and localised small scale mining may have occurred.
12	550.0	NW	Not available	Chalk	Rare and localised small scale mining may have occurred.
13	635.0	S	Not available	Chalk	Rare and localised small scale mining may have occurred.
14	651.0	NW	Not available	Chalk	Rare and localised small scale mining may have occurred.
Not shown	849.0	SE	Not available	Chalk	Rare and localised small scale mining may have occurred.
Not shown	943.0	S	Not available	Chalk	Rare and localised small scale mining may have occurred.

3.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

3.6 Natural Cavities

This dataset provides information based on Peter Brett Associates natural cavities database.

Are there any Natural Cavities within 1000m of the study site boundary? Yes

The following Natural Cavities information provided by Peter Brett Associates:

ID	Distance (m)	Direction	NGR	Superficial Deposits	Bedrock Deposits	Cavity Type and Number
17	65.0	NW	512200 214600	Clay-with-Flints	Chalk Group	Sinkhole x 1, Solution Pipe x 1

3.7 Brine Extraction

This data provides information from the Coal Authority issued on behalf of the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

3.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

3.9 Tin Mining

This dataset provides information on tin mining areas and is derived from tin mining records. This search is based upon postcode information to a sector level.

Are there any Tin Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

3.10 Clay Mining


This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.

Are there any Clay Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

4 Natural Ground Subsidence


4.1 Shrink-Swell Clay Map

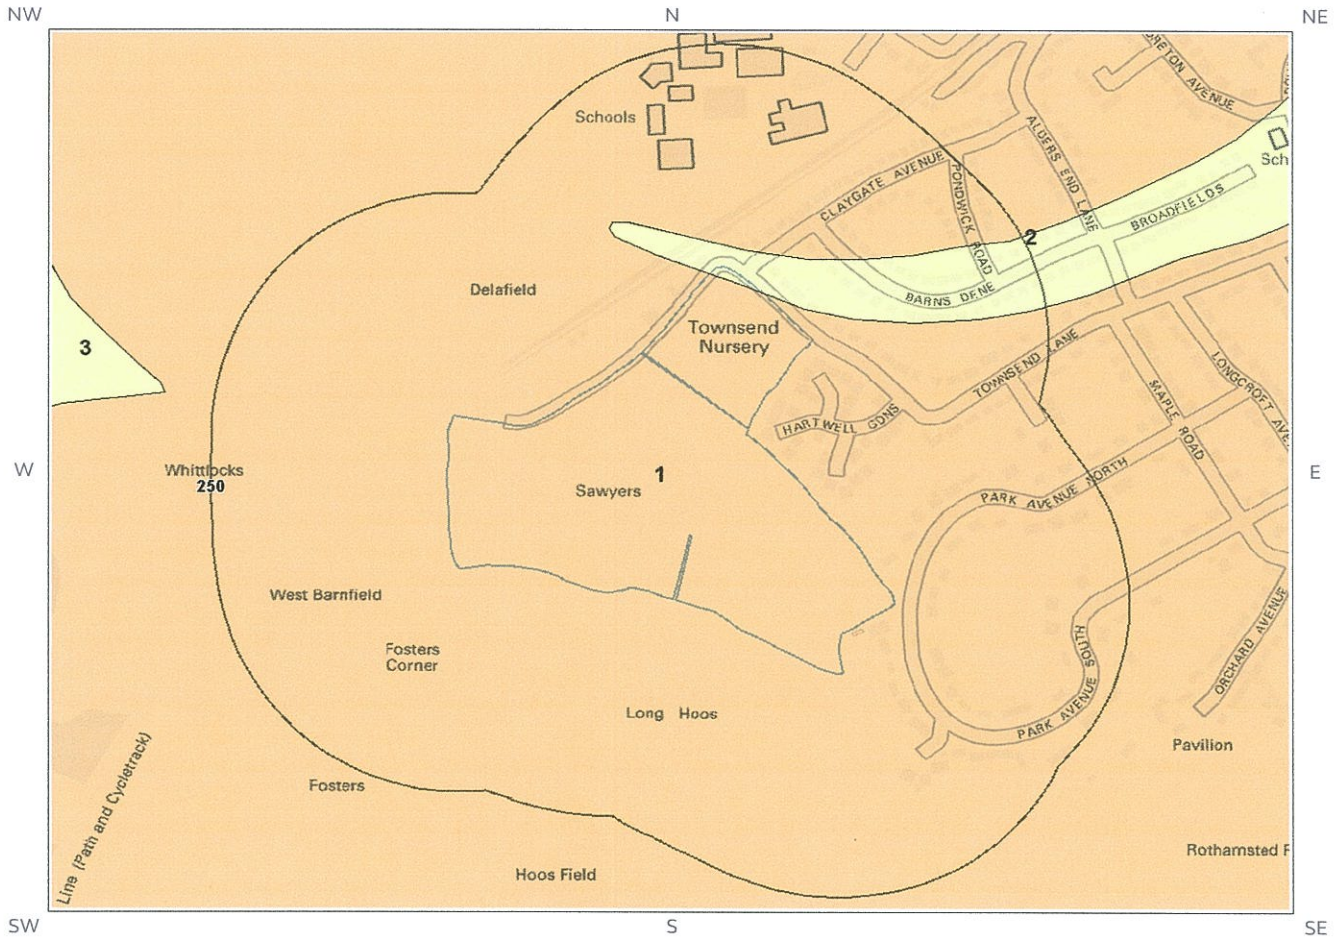


Shrink Swell Clay Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

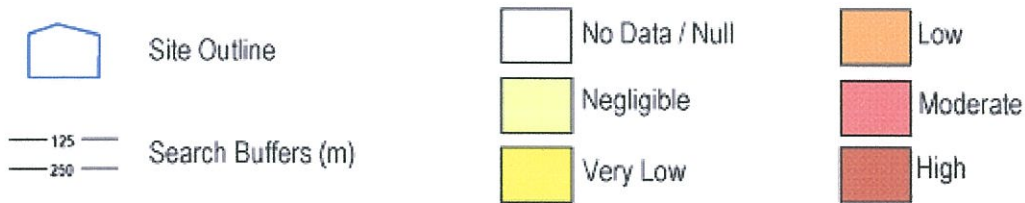

4.2 Landslides Map

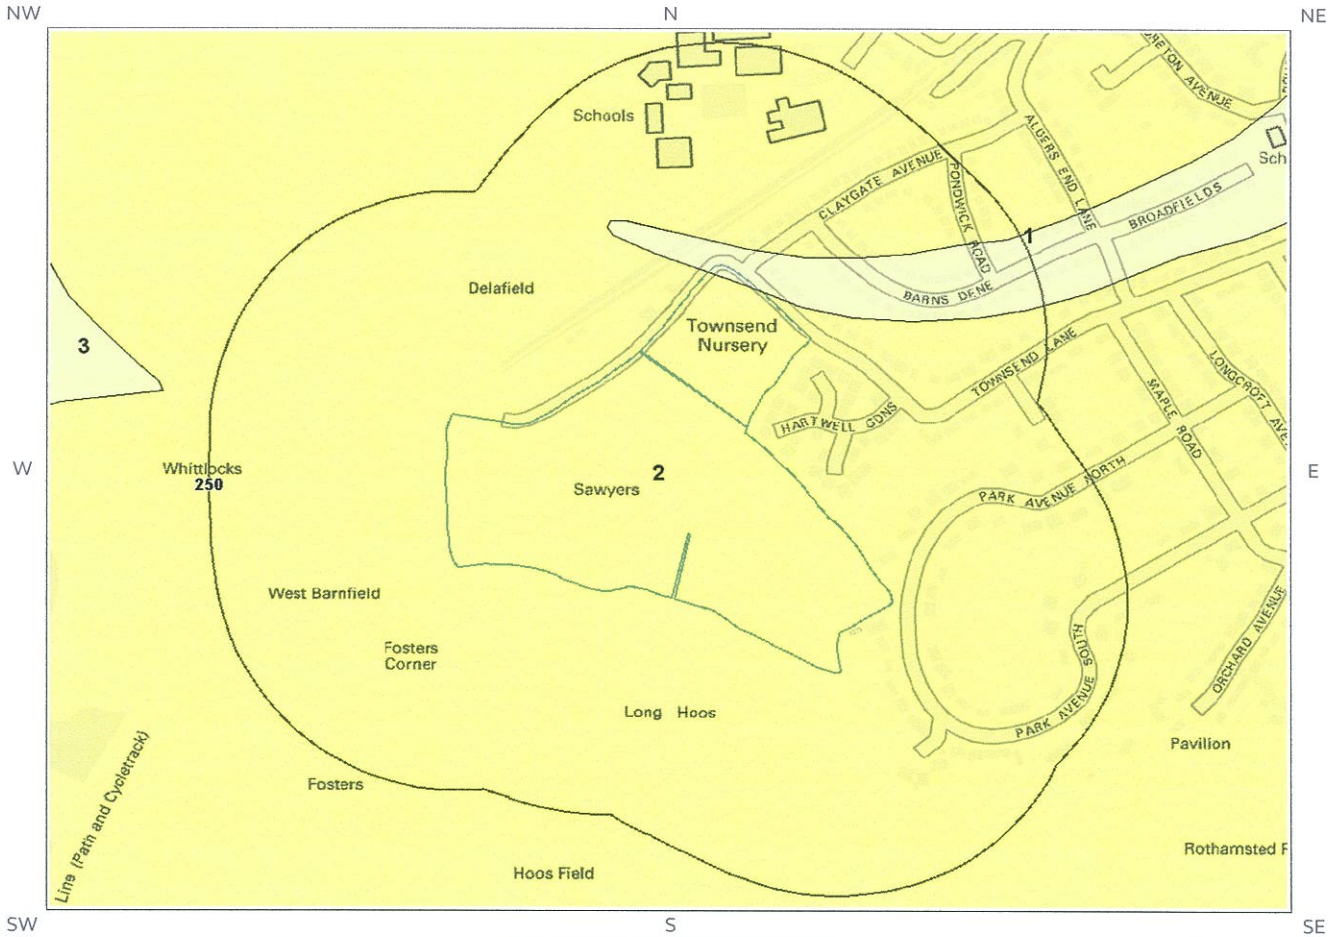


Landslides Legend




© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

-  Site Outline
-  125 Search Buffers (m)
-  250 Search Buffers (m)

-  No Data / Null
-  Negligible
-  Very Low

-  Low
-  Moderate
-  High





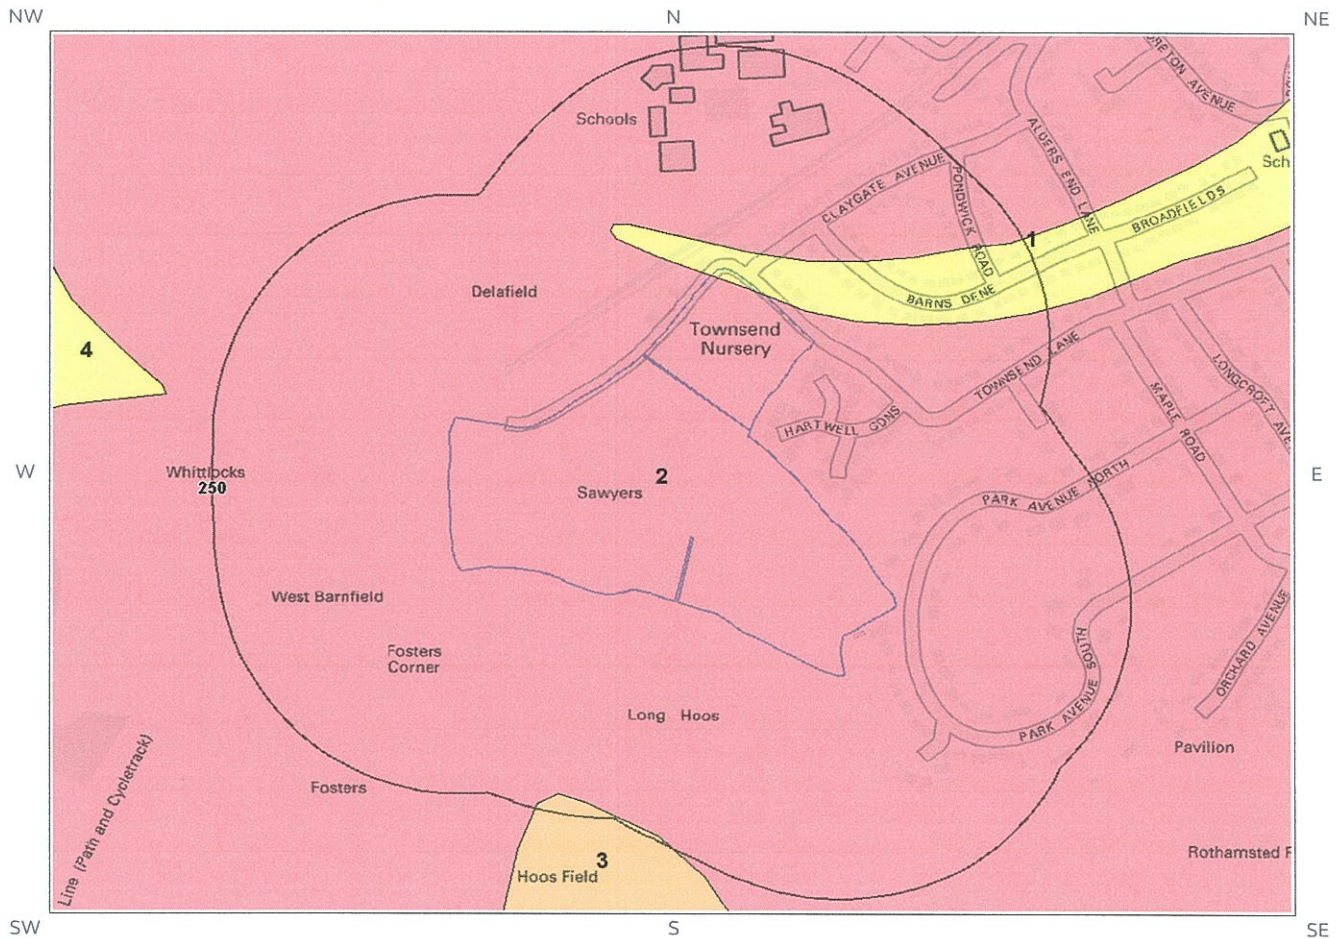




4.3 Ground Dissolution Soluble Rocks Map




Ground Dissolution Soluble Rocks Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

- | | | | | | |
|---|------------------------|---|----------------|---|----------|
|  | Site Outline |  | No Data / Null |  | Low |
|  | 125 Search Buffers (m) |  | Negligible |  | Moderate |
|  | 250 Search Buffers (m) |  | Very Low |  | High |

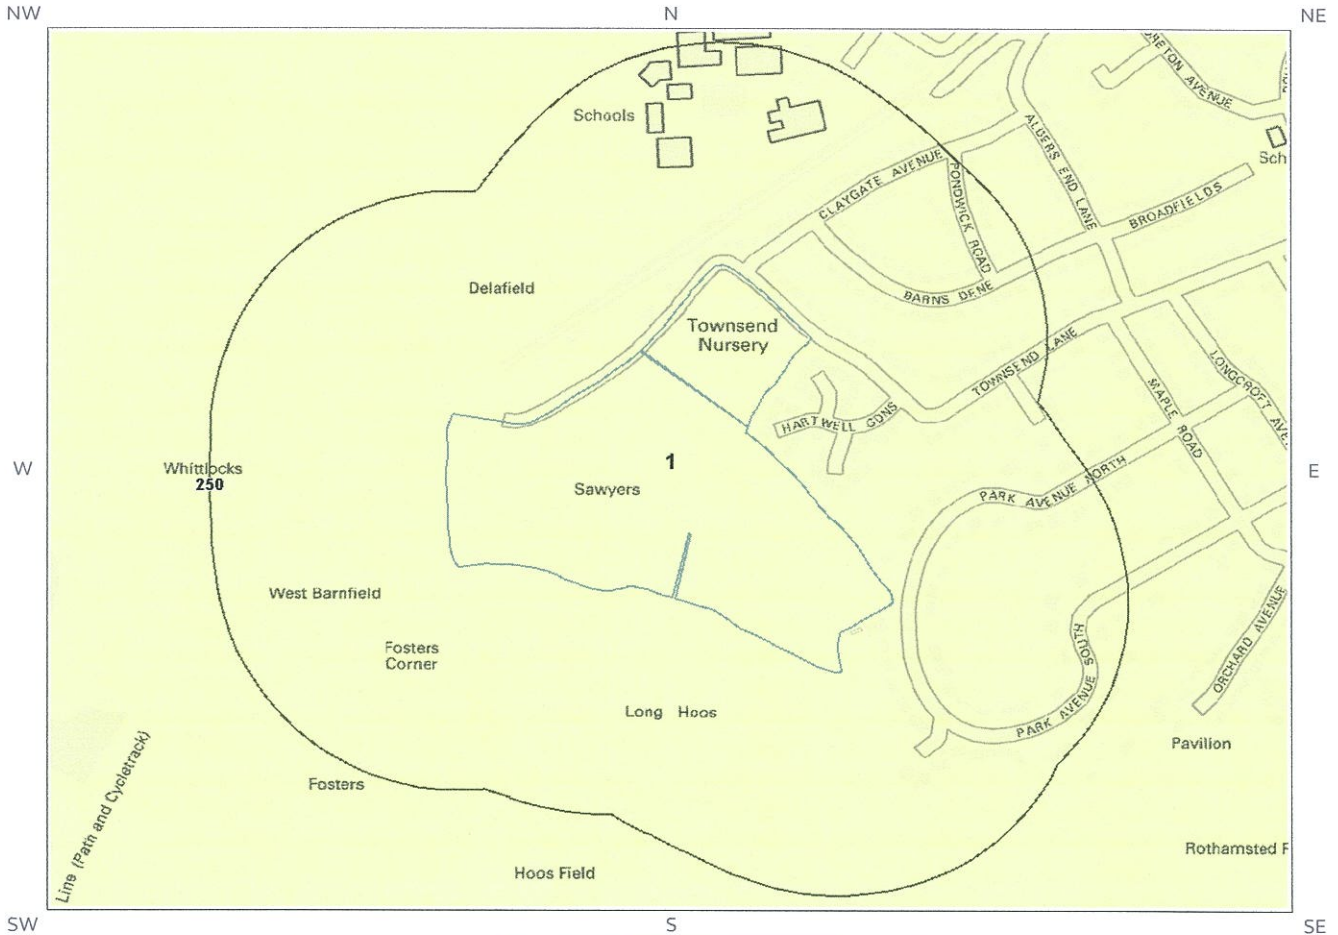


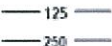




4.4 Compressible Deposits Map




Compressible Deposits Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

	Site Outline		No Data / Null		Low
	Search Buffers (m)		Negligible		Moderate
			Very Low		High


4.5 Collapsible Deposits Map

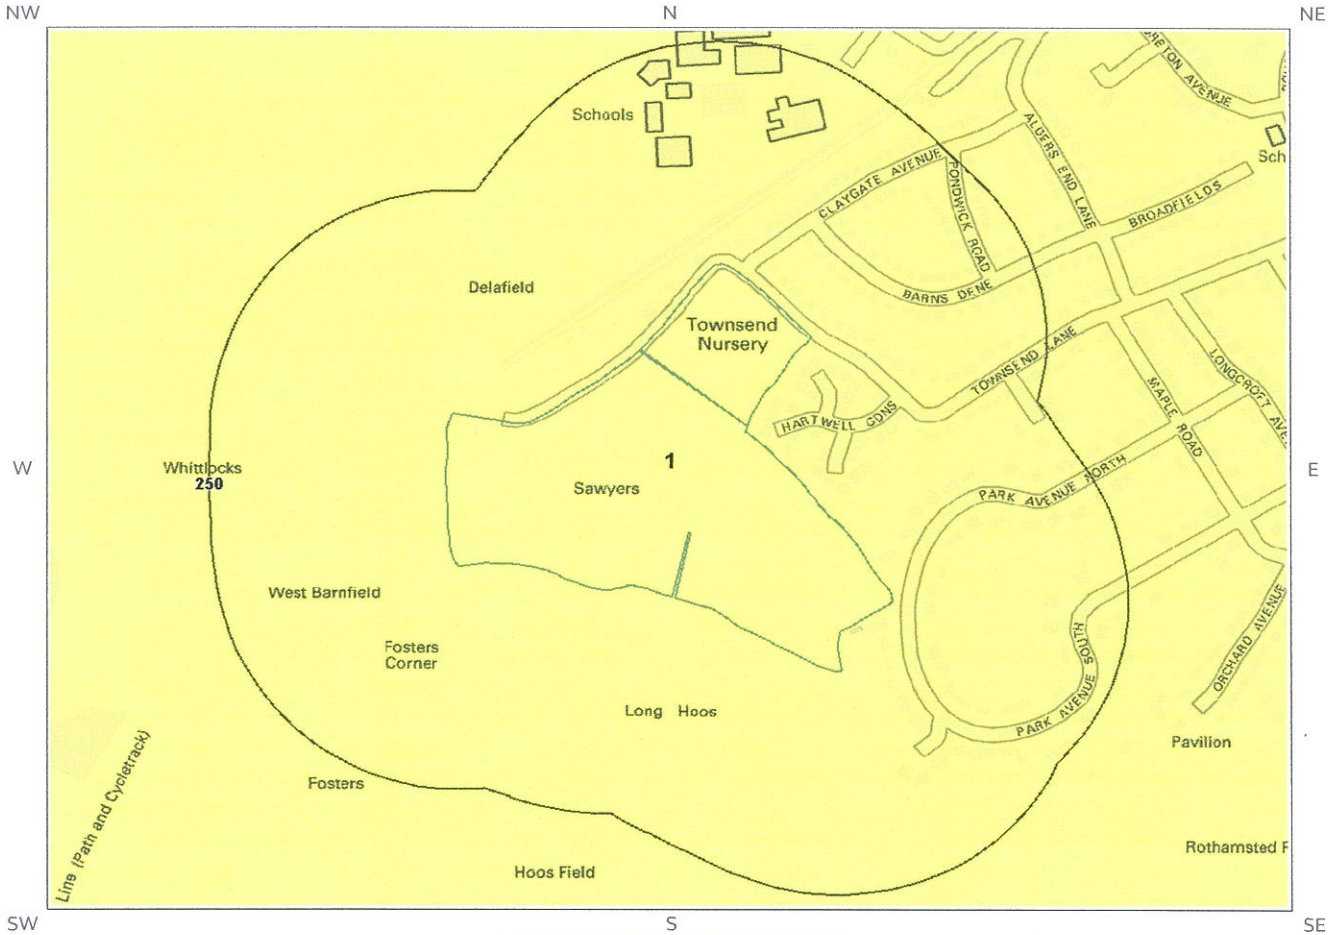


Collapsible Deposits Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

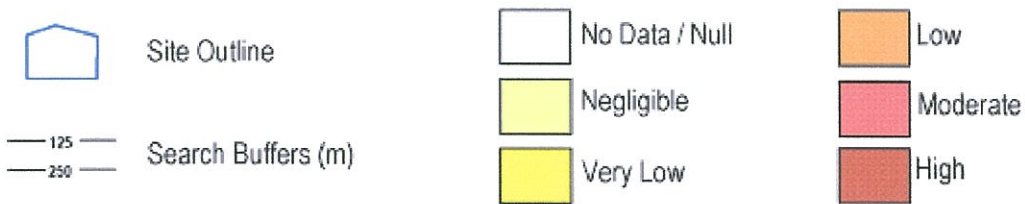



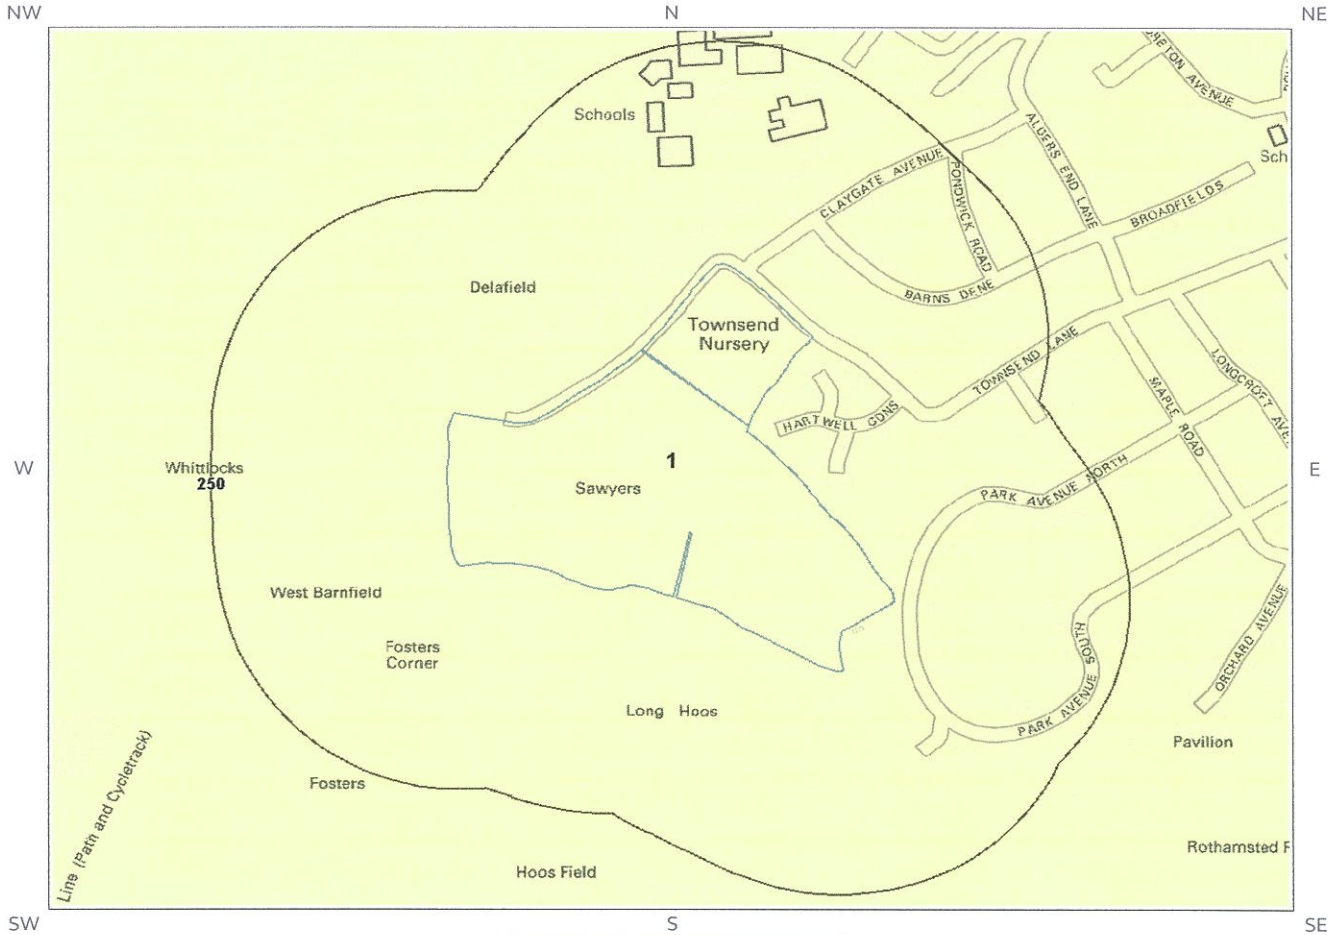






4.6 Running Sand Map



Running Sand Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

- | | | | | | |
|---|--------------------|---|----------------|---|----------|
|  | Site Outline |  | No Data / Null |  | Low |
|  | Search Buffers (m) |  | Negligible |  | Moderate |
|  | |  | Very Low |  | High |

4 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site** boundary? Moderate

4.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Low	Ground conditions predominantly medium plasticity. Do not plant trees with high soil moisture demands near to buildings. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a possible increase in construction cost to reduce potential shrink swell problems. For existing property, there is a possible increase in insurance risk, especially during droughts or where vegetation with high moisture demands is present.
2	0.0	On Site	Negligible	Ground conditions predominantly non-plastic. No special actions required to avoid problems due to shrink-swell clays. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with shrink-swell clays.

4.2 Landslides

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for slope instability identified. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.
2	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

* This includes an automatically generated 50m buffer zone around the site

4.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Significant soluble rocks are present. Problems unlikely except with considerable surface or subsurface water flow. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, or increased construction costs are likely. An increase in financial risk due to potential problems with soluble rocks is unlikely.
2	0.0	On Site	Moderate	Very significant soluble rocks are present with a moderate possibility of local natural subsidence due to high surface or subsurface water flow. Do not load the land or undertake building work before obtaining specialist advice. Do not dispose of drainage to the ground. Some possibility groundwater pollution. Maintain drainage infrastructure. For new build, specialist site investigation and stability assessment may be necessary before construction. Construction work may cause subsidence. Increased construction costs are likely. For existing property, probable increase in insurance risk due to soluble rocks.

4.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for compressible ground identified. No special actions required to avoid problems due to compressible ground. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with compressible ground.

4.5 Collapsible Deposits

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Deposits with potential to collapse when loaded and saturated are unlikely to be present. No special ground investigation required or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

4.6 Running Sands

The following Running Sands information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for running sand identified. No special actions required to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.



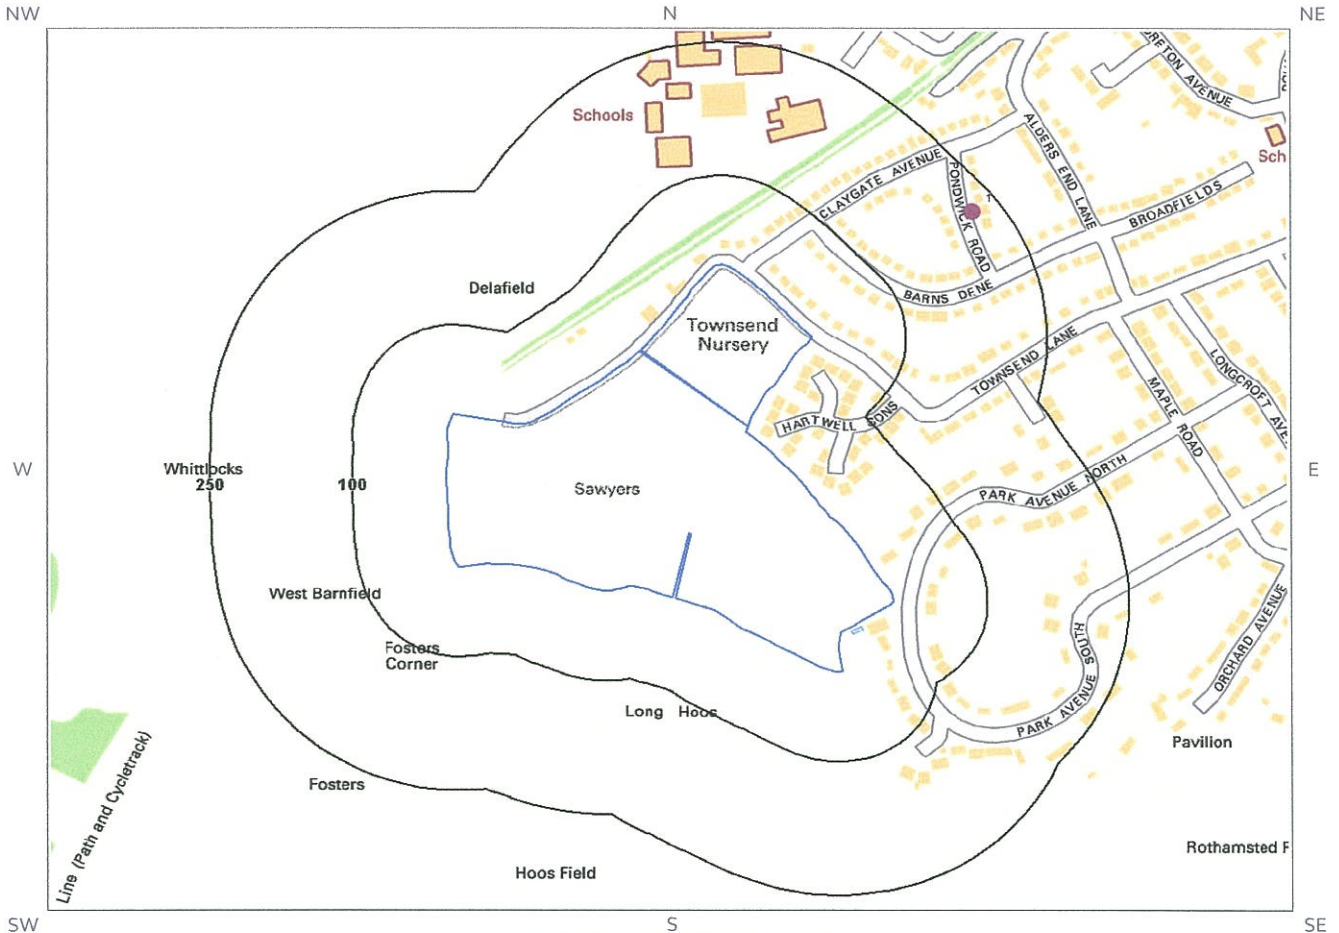

5 Borehole Records Map



Borehole Records Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.

-  Site Outline
-  Borehole Locations
-  125 Search Buffers (m)
-  250 Search Buffers (m)

5 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary: 1

ID	Distance (m)	Direction	NGR	BGS Reference	Drilled Length	Borehole Name
1	221.0	NE	512500 214600	TL11SW56	61.0	44 WEST COMMON WAY, HARPENDEN

The borehole records are available using the hyperlinks below: Please note that if the donor of the borehole record has requested the information be held as commercial-in-confidence, the additional data will be held separately by the BGS and a formal request must be made for its release.

#1: scans.bgs.ac.uk/sobi_scans/boreholes/18511780

6 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


14

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geosight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	90 - 120 mg/kg	30 - 45 mg/kg	<100 mg/kg
13.0	NE	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	90 - 120 mg/kg	30 - 45 mg/kg	<100 mg/kg
71.0	N	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
84.0	S	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
85.0	E	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
126.0	N	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
163.0	SE	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
173.0	E	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	90 - 120 mg/kg	30 - 45 mg/kg	<100 mg/kg
176.0	E	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	90 - 120 mg/kg	30 - 45 mg/kg	<100 mg/kg
200.0	S	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
202.0	NE	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg

*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.



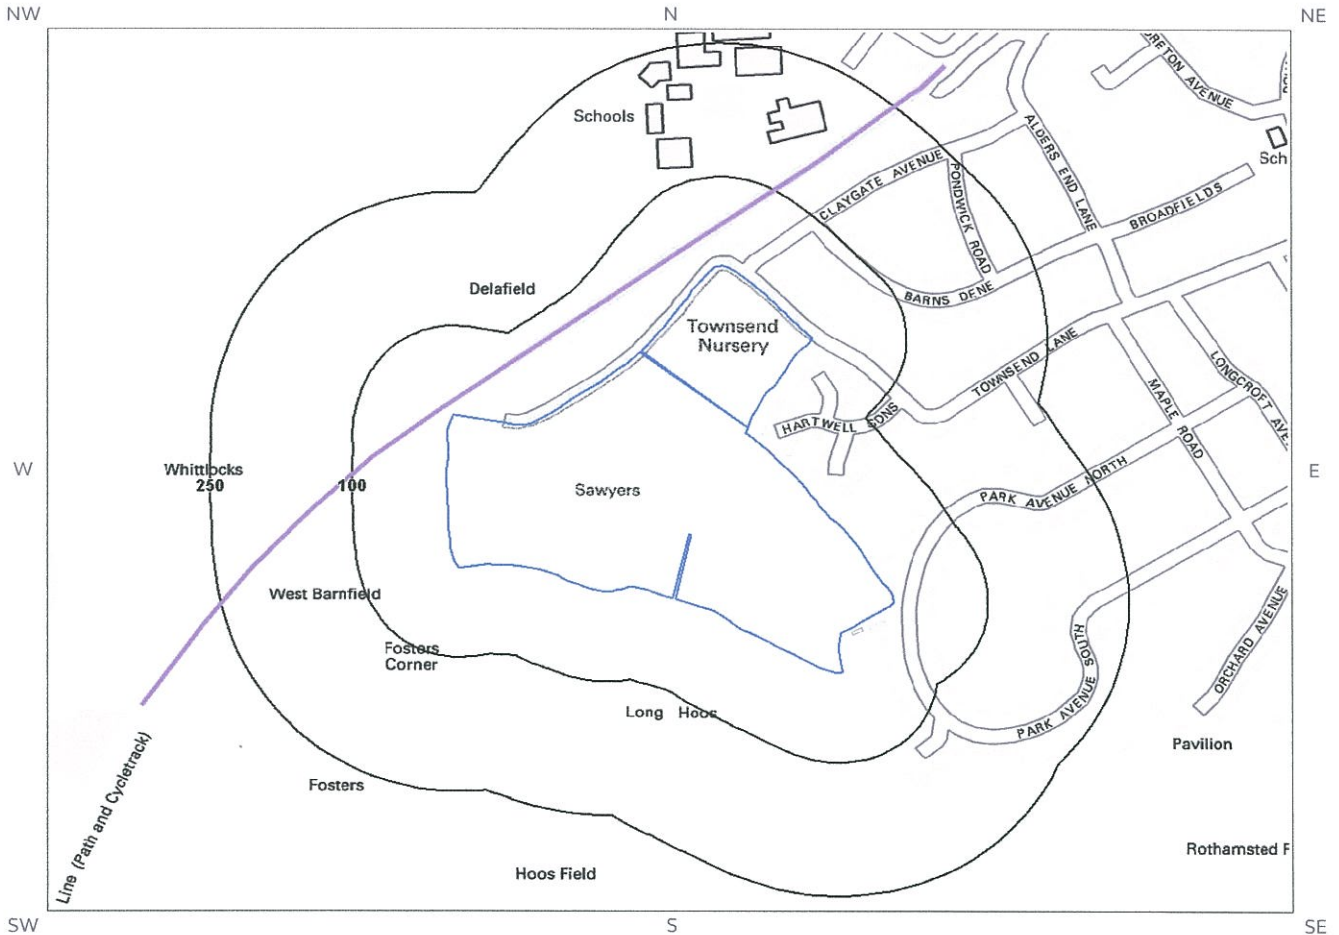







7 Railways and Tunnels Map



Railways and Tunnels Legend



© Crown copyright and database rights 2015.
Ordnance Survey license 100035207.
© OpenStreetMapContributors

- | | | | | | |
|---|-----------------------------|---|--|---|---|
|  | Site Outline |  | Underground or Partially Underground Railway / Subway System |  | Railway Track (OpenStreetMap) |
|  | Railway Tunnel (OS Mapping) |  | High Speed 2 |  | Abandoned or Dismantled Railway (OpenStreetMap) |
|  | 250 Search Buffers (m) |  | Railway Track (OS Mapping) |  | Railway and/or Tunnel Feature from Historical Mapping |
|  | 500 Search Buffers (m) | | | | |

7 Railways and Tunnels

7.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels Map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels Map.

7.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? No

Have any historical railway or tunnel features been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels Map.

7.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary?	No
Have any historical railway lines been identified within 250m of the study site boundary?	Yes

Distance (m)	Direction	Status
13	NW	Abandoned
14	NW	Abandoned

Note: multiple sections of the same track may be listed in the detail above

Any records that have been identified are represented on the Railways and Tunnels Map.

7.4 Active Railways

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary?	No
Have any active railway lines been identified within 250m of the study site boundary?	No

Database searched and no data found.

Note: multiple sections of the same track may be listed in the detail above

Any records that have been identified are represented on the Railways and Tunnels Map.

7.5 Railway Projects

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project?	No
Is the study site within 500m of the route of the Crossrail 1 rail project?	No

*Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a **Groundsure HS2 and Crossrail 1 Report**.*

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Appendix D

Photographs



Photo 1: view across the site from the current entrance at the southern corner, looking north-west.

Photo 2: view across the site towards the current site entrance, looking south, with the south-eastern site boundary on the background on the left.





Photo 3: view of the mature conifers along the south-eastern site boundary, located just outside the site.

Photo 4: view of the mature oak trees along the north-western site boundary, located just within the site.





Photo 5: view of the arisings from WS1, showing the boundary between Clay-with-Flints and the underlying Chalk.

Photo 6: view of WS2 during drilling, looking north.

